Monroe County Surveyor's Office Corner ID: Polk_G21

Polk_G21

LAND CORNER RECORD

Index: V-7	Corner: 1/4 Corner between Sections 29 and 32			*State of Indiana - Hoosier National Forest*
Section: 29	Township: 7N	Range: 1E	P.M.: 2nd	County: Monroe
Coordinate:	Lat./N: 1369099.77	Long./E: 3137416.49		Datum: NAD83 IN West Zone, US Survey Feet

CORNER HISTORY: (Chronological history of corner)

1.) Date of Survey:	Surveyor:	Monument:	Recording Information:	Monument Photograph:
1856	M. H. Buskirk Monroe County Surveyor	Stone set	Monroe County Surveyor's Office	

Reference Objects:	Species:	Diameter:	Bearing:	Distance:
	C. Oak	14"	N21°E	20 lks
	Poplar	25"	S46°E	14 lks

Record evidence of prior survey: Tim Albright searched for the monument from a Land Corner Record dated 11/23/1991 and found nothing.

2.) Date of Survey:	Surveyor:	Monument:	Recording Information:
2/20/2007	Kevin Enright Monroe County Surveyor	3/4" Rebar found.	Monroe County Surveyor's Office Bk. 38, Pg. 69

Reference Objects:	Species:	Diameter:	Bearing:	Distance:
	Oak	20"	N74°W	30.65'
	Post w/"SURVEY" sign	N/A	N04°E	0.20'
	Post w/Mag	5"X7"	S89°E	64.28'

Record evidence of prior survey: The monument N25°W - 7.60' of the edge of asphalt.

ACCESSORIES: Bearing and distance from monument to witness object.

Reference Objects:	Object or Tree Species:	Diameter:	Bearing:	Distance:
	Pignut Hickory	13"	N10°E	55.30'
	Sugar Maple	10"	N69°W	25.40'
	Wood Post	6"X6"	S73°E	63.35'
	Phone Riser	N/A	N70°E	60.00'

Monument Found or Set: A 3/4" rebar with a 1/2" rebar on the northwest side found 0.3' above grade.

MONUMENT SKETCH

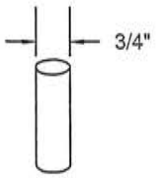

NARRATIVE REFERENCE:

Monument is a 3/4" rebar with a 1/2" rebar on the northwest side found 0.3' above grade, a carsonite post is located north 0.5' of the monument, located 8' north of a county road, +/- 150' west of a wood sided one story house, 10' north of the centerline of a powerline, a t-post with a "SURVEY MARKER" sign is 0.1' north.

SECTION DIAGRAM

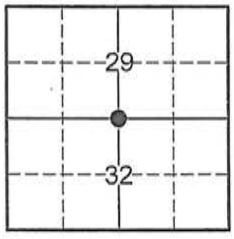

Corner Location = ●

PERPETUATION RECORD:

The record monument was found undisturbed and maintained by marking two new bearing trees and two other reference objects.

Two bearing trees were marked with a blaze, scribed B.T., bearing tree sign, paint, and mag nail.

Referenced on BRCJ survey recorded as InstNo.2018004725

Accepted by the Monroe County Surveyor Review Board on August 6, 2019.

Section: 29 T7N R1E | Prepared By: BRCJ (Project#3-0820) | Date: 2/2018

Monroe County Surveyor's Office Corner ID: Polk_G21

MONUMENT RECORD
State of Indiana - County of Monroe

Section: 29 **Township:** 7 North **Range:** 1 East **Corner ID:** Polk G-21

Monument Description & Remarks: 3/4" rebar with 1/2" rebar witness on its West face; broken stone found placed on top. Survey Sign 4.5ft above ground at pt. C
References On File: Legal Survey Book 2 page 418 survey (1885); Steven W. Archer survey, Russel & Paul Smith (1998), on file in Surveyor Office

RECOVERY TIE DRAWING
Field Book 38 Page No. 69

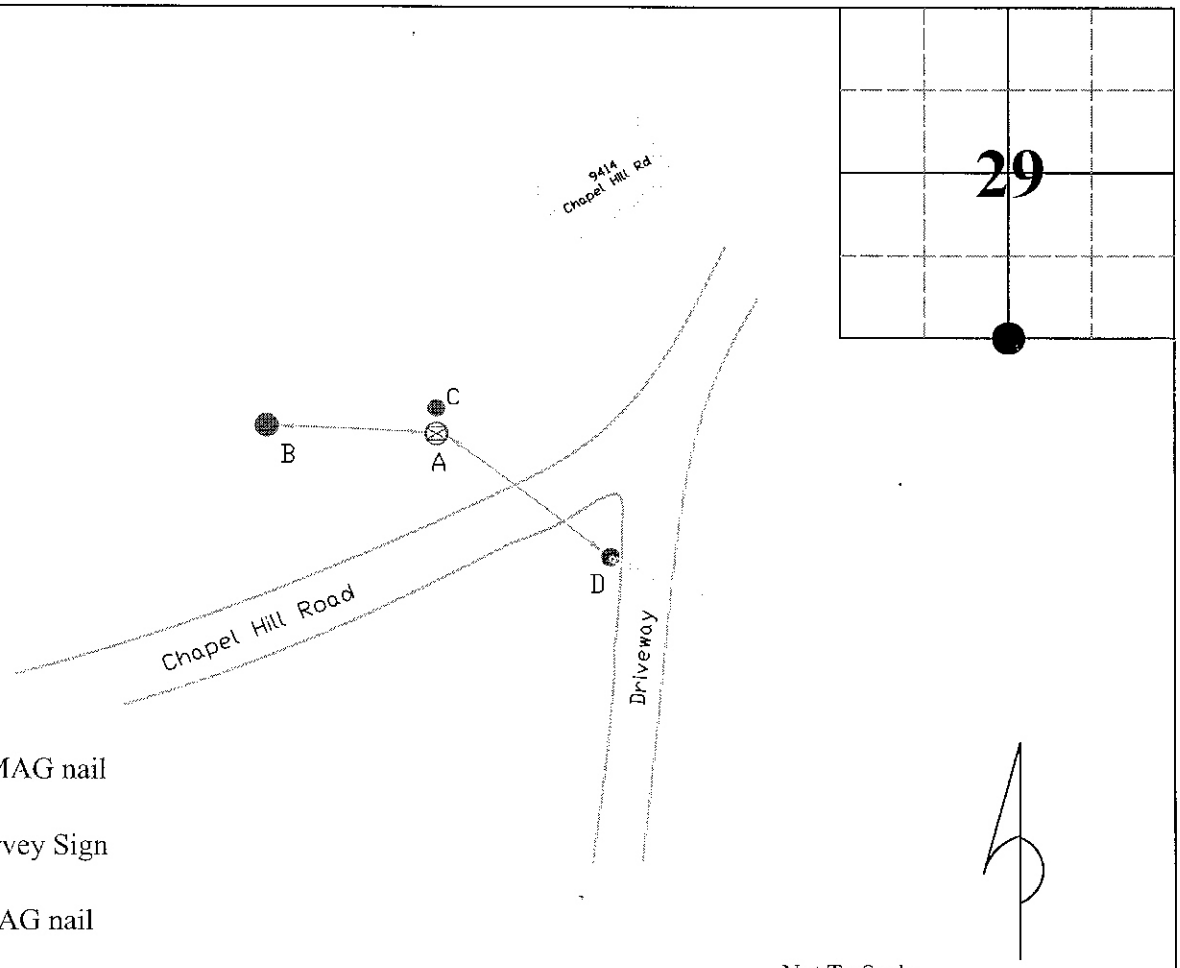

A - 3/4" rebar
B - N 74° W 30.65' to MAG nail in 20" Oak
C - N 04° E 0.20' to Survey Sign on metal fence post
D - S 89° E 64.28' to MAG nail in 5"x7" post
E - S 25° E 7.60' to edge of asphalt

Not To Scale
Compass Bearing Magnetic North

I, Kevin P. Enright, Monroe County Surveyor, hereby certify that this document was prepared under my direction in accordance with the provisions of section 36-2-12-11 of the Indiana Code; and the above data is given under my hand and seal this 2nd day of January, 2007.

Kevin Enright

SEAL
SURVEYOR
MONROE COUNTY INDIANA

Administered by the Monroe County Surveyor Review Board

Date: 2/20/2007 DB

MONROE COUNTY
SEAL
SURVEYOR REVIEW BOARD

Drawn by: T.E.R Print date: January 16, 2007

Monroe County Surveyor's Office Corner ID: Polk_G21

Polk_G21

Index No V7
T. 7N R. 1E 2nd P.Mer. County MONROE State of Indiana
1/4 Corner common to Sections 29 & 32 Hoosier National Forest

FSM 7150

LAND CORNER RECORD

EXISTING SURVEYS

Original Government Survey
Year Surveyed 4/13/1856 By M/H Buskirk
Original Monument ____

BT's	Species	Dia	Bearing	Dist

Original Survey evidence Found
Date of Search 1990 By D. Morris
Monument Found ____

Orig. BT's Found	Species	Dia	Bearing	Dist

Subsequent Corner Restoration
Date Surveyed 1856 By M/H Buskirk
Where Filed or recorded: MONROE
Book: A1 Page 271 · Co. Surveyor

Monument Set STONE

BT's	Species	Dia	Bearing	Dist
Ref.	C. OAK	14"	N21 E	20 LKS
Obj.	POPLAR	28"	S76 E	14 LKS

Evidence of Subsequent Corner Restoration Found
Date of Search 11-22 By Tim Albright
Monument Found NONE

BT's Found	Species	Dia	Bearing	Dist

Subsequent Corner Restoration
Date Surveyed ____ By ____
Where Filed or recorded: ____
Book: ____ Page ____

Monument Set ____

BT's	Species	Dia	Bearing	Dist
Ref.				
Obj.				

Evidence of Subsequent Corner Restoration Found
Date of Search 11-22 By Tim Albright
Monument Found NONE

BT's Found	Species	Dia	Bearing	Dist

OTHER EVIDENCE

Describe corner location relative to nearby features and how to reach the corner location - note fences roads, timber, streams, topo changes, etc:
REBAR 7" High 6 Ft W. From Fence Row.

No Stone was found during search.

Sketch of Monument

PERPETUATION RECORD

Monument: Describe new monument set, or work done to preserve existing monument.

CORNER DIAGRAM

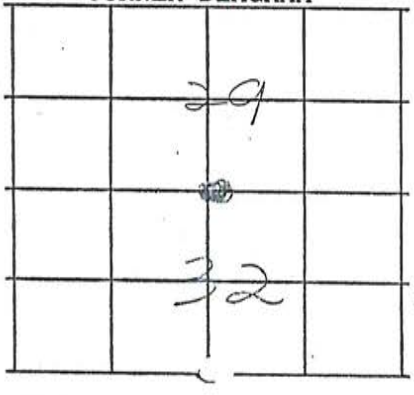

Accessories: Describe new Bt's and/or witness objects established or work done to preserve existing evidence

Photo Identified
Photo # ____
Strip/Series ____
Pinpricked ____
Manhours in Search ____

Corner Recordation Certificate prepared: Yes ____ No ____
Filed or recorded in County Records: Date: ____
Book: ____ Page: ____

Corner Record by: Tim Albright Date: 12-7-91

Monroe County Surveyor's Office Corner ID: Polk_G21

Index No. V -7 (Alphabetical - Numerical)

LAND CORNER RECORD (RECTANGULAR SURVEYS)

R9-7100-74 (Rev. 5/80)

T. 7 n R. 1 E 2nd P Mer. N.F. Hoosier County Monroe State Indiana

1/4 section corner Corner common to sections , , 29 and 32

EXISTING SURVEYS

Original Government Survey

Year surveyed 1814 - Arthur Henrie D.S.

Original monument Not called for (Wood post, stone, pile of stones, pipe, etc.)

Bearing Trees

Species	Gum	Maple
Diameter	12"	10"
Bearing	N81E	N34W
Distance	29 lk	18 lk

Original Evidence Found

Year of search 1988 By R. Ratcliff

Monument found None R.L.S.#S0343

Original Bearing Trees Found

Species		
Diameter	None	
Bearing		
Distance		

Subsequent Corner Restoration

Year surveyed 1860 By J.S. Buskirk MCS.

Where filed or recorded Monroe Co. Surveyor

Monument Not called for (Original, concrete post, iron pipe, etc.)

Bearing Trees, Reference Objects

Species	R. Oak	W. Oak
Diameter	3"	3"
Bearing	N29W	N5E
Distance	26 lk	30 lk

Evidence of Subsequent Corner Restoration Found

Year of search 1988 By R. Ratcliff R.L.S.#S0343

Found old stone with "+" on top fence lines E, W, and North.

Bearing Trees, Reference Objects

None

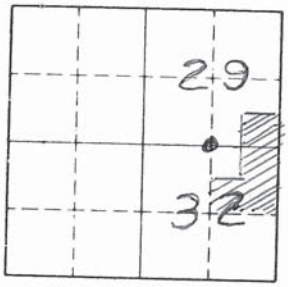

Sketch

○ Corner ▨ F.S. Land

Relation of Evidence to Record Features Along Section Lines

Section line to sections

Object

Record distance

Measured distance

Other Evidence

Describe evidence of use and occupation such as roads, fences, clearings, timber cutting lines, plantations, etc.. Cite source of testimony if any.

Adjoining owner showed us the approximate location of stone. Deed dimension East to road centerline checked. fence East, West and North.

At time of search:

1. Did you have the record description? Yes x No

2. How was search area located? Pacing, chaining, photos, maps, etc. Maps & Traverse

3. Man hours spent in search 1

4. Do you think additional search might recover evidence? Yes No x

5. Signature [signature]

Perpetuation Record

Monument and accessories established. Include brief description of area.

Stone left undisturbed.
No accessories established.

Certified corner restoration certificate prepared: Yes No x

Filed in county records at Date County Document No.

Identifed on aerial photo No. Which is filed at

Index No. V-7 (Alphabetical – Numerical)

LAND CORNER RECORD
(RECTANGULAR SURVEYS)

R9-7 150-4 (Rev. 6/13/67) GPO 806-924

T. 7N R. 1E 2 Mer. N.F. Hoosier County Monroe State Ind

W Section 29 Corner common to sections 29, 32, and

EXISTING SURVEYS

Original Government Survey

Year surveyed

Original monument Wood Post (Wood post, stone, pile of stones, pipe, etc.)

Bearing Trees

Species	Gum	Maple		
Diameter	12"	10"		
Bearing	N 81 E	N 34 W		
Distance	29 lks	18 lks		

Original Evidence Found

Year of search 1972 By H. Deaton B. Aynes

Monument found No

Original Bearing Trees Found

Species				
Diameter				
Bearing	None			
Distance				

Subsequent Corner Restoration

Year surveyed 1865 By Bowyer

Where filed or recorded Mo Co Surv Bk 1 p 48

Monument (Original, concrete post, iron rod, etc.)

Bearing Trees, Reference Objects

Species	Chestnut	Red Oak		
Diameter	12"	12"		
Bearing	S 81 W	N 71 W		
Distance	40 lks	40 lks		

Evidence of Subsequent Corner Restoration Found

Year of search 1972 By H. Deaton B. Aynes

found sandstone on surface with + Stone lies in corner of a fence from North and West on North bank of road west of Mobile Home. Stone has possibly been move it was not planted in ground

Bearing Trees, Reference Objects

None

7N 1E

Sketch

○ Corner ▨ F.S. Land

At time of search:

1. Did you have the record description? Yes ✓ No

2. How was search area located? Pacing, chaining, photos, maps, etc. Deed descriptions

3. Man hours spent in search 2a

4. Do you think additional search might recover evidence? Yes ✓ No

5. Signature Henry Deaton

Relation of Evidence to Record Features Along Section Lines

Section line to sections				
Object				
Record distance				
Measured distance				

Other Evidence

Describe evidence of use and occupation such as roads, fences, clearings, timber cutting lines, plantations, etc.. Cite source of testimony if any.

Perpetuation Record

Monument and accessories established. Include brief description of area. Elmer Thompson's Deed Called 1967 Noted the Center Line of county road is 40 feet East of corner, N.S. measured from the ℄ of road 5'40" to the Stone

Certified corner restoration certificate prepared: Yes No

Filed in county records at Date County Document No.

Identified on aerial photo No. Which is filed at